OSI SINGLE-PHASE AC RMS CURRENT TRANSDUCER MODEL ACTR-

ACCURATE TO 0.25% FULL-SCALE

FEATURES

- Accurate measurement of the true RMS value of input signals over a wide frequency range.
- Input/output isolation.

APPLICATIONS

- For use in applications where measurement of non-sinusoidal waveforms is required.
- · Designed to withstand motor start-up transients.



Measuring Equipment 7N93



YEAR

RANTY



MODEL SELECTION

INPUT	STANDARD OUTPUTS MODEL ACTR-				
AMPS AC	0-1mAdc	4-20mAdc	0-10Vdc	0-5Vdc	
0 - 1	001B	001E	001D	001X5	
0 - 5	005B	005E	005D	005X5	
0 - 10	010B	010E	010D	010X5	
0 - 15	015B	015E	015D	015X5	
0 - 20	020B	020E	020D	020X5	

All standard units require 115Vac instrument power. Optional 230Vac instrument power - Add suffix "-22".

ORDERING INFORMATION

Example: 15Aac Input with 0-10Vdc Output. ACTR-015D

SPECIFICATIONS


INPUT

Current	See Table	
Frequency Range	48-420Hz	
Burden	0.28VA F.S.	
Current Overload (w/o damage)		
1-10A Range	. 2 X Rating (continuous)	
15-20A Range 25	A maximum (continuous)	
10 X Rating for one-second	d transient 10s/hr	

DIELECTRIC TEST

Input/Output/Case	. 2200Vac
-------------------	-----------

INSTRUMENT POWER

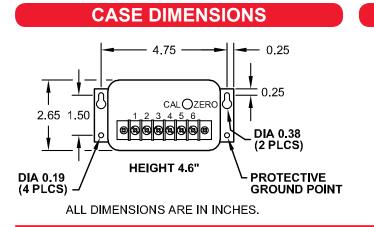

OHIO SEMITRONICS, INC

OUTPUT

Туре	See Table
Loading B models	
D & X5 models	2kΩ, min.
E models	0-500Ω
Response Time (to 90% F.S.)	100ms
Field-adjustable Calibration	±10%


ACCURACY (Includes Effects of Linearity and Set Point)

At 60Hz	±0.25% F.S.
	(±0.5% typical over frequency range)
Output Ripple	<1.0% F.S.

TEMPERATURE & PHYSICAL

Operating Range	20 to 60°C
Effect	±1.0% Rdg.
Net Weight	1.5 Lbs.

CONNECTION DIAGRAM

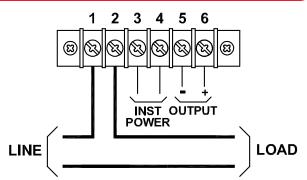

Dwg# 0902-00919-B Rev A

4242 REYNOLDS DRIVE * HILLIARD, OHIO * 43026-1264 PHONE: (614) 777-1005 * FAX: (614) 777-4511 WWW.OHIOSEMITRONICS.COM * 1-800-537-6732

OSI INSTALLATION & OPERATION INSTRUCTIONS MODEL ACTR-

INSTALLATION INSTRUCTIONS

- 1. Installation should be performed by qualified electricians only!
- 2. Verify that electrical service is disconnected before making any electrical connections.
- 3. Branch circuit protection is required to be provided in accordance with the National and Local codes of the inspection authority.
- 4. Route wires as required and secure to terminals per connection diagram on this sheet and on the unit.
- 5. Attach the Protective Ground Point () to earth ground by mounting to a grounded enclosure or by attaching a ground wire. Paint barrier on can must be broken by using an internal-tooth lock-washer or similar device.

OPERATING INSTRUCTIONS

- 1. This unit is intended for indoor use at altitudes up to 2000 meters.
- 2. Transient overvoltages according to Installation Category (overvoltage category) II, pollution Degree 2.
- 3. The output signal is intended to be "Not accessible to the user." To prevent contact with live circuits, the transducer is required to be mounted in an enclosure that requires the use of a tool for access.
- 4. If cleaning of the exterior surface is necessary, de-energize all services of supply (both measuring and instrument power circuits) and brush with a soft brush or blow off with low-pressure air. Use appropriate eye protection. Not suitable for hose-down cleaning.
- 5. Maximum relative humidity 80 percent for temperatures up to 31°C decreasing linearly to 50 percent relative humidity at 40°C.
- 6. Maximum operating temperature range is -20°C to 60°C.

WARRANTY STATEMENT

Ohio Semitronics Inc. warrants this unit to be free of defects in material and workmanship for a period of five years from date of shipment. This unit must not be used in any manner other than as specified in this document.

OHIO SEMITRONICS, INC. 4242 REYNOLDS DRIVE * HILLIARD, OHIO * 43026-1264 PHONE: (614) 777-1005 * FAX: (614) 777-4511 WWW.OHIOSEMITRONICS.COM * 1-800-537-6732